

Manhole Inspection Summary

Manhole # S04I__007MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **04I** Node: **007** Status: **Found**

Insp Date: **4/1/09 9:53 AM**

Incomplete Comments

Crew: **SD WJ**
Inspector: **Lamont**
Firm: **URS**

Location Address: **414 KENSINGTON RD**

Cross Street: **N CHAPELGATE LN**

Manhole Type: **Inline** Location: **Buried**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Concrete and Stone** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Concrete and Stone** ☐ Parged

Shape: **Rectangular** Diameter: **48** (in.) Length: **48** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☐ Exists Material: ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Unknown** ☐ Parged

Channel Exposure: **Partially Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **1** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



GRADE ADJUSTMENT




Defect 2




O12 PIPE SEAL BROKEN

Top View

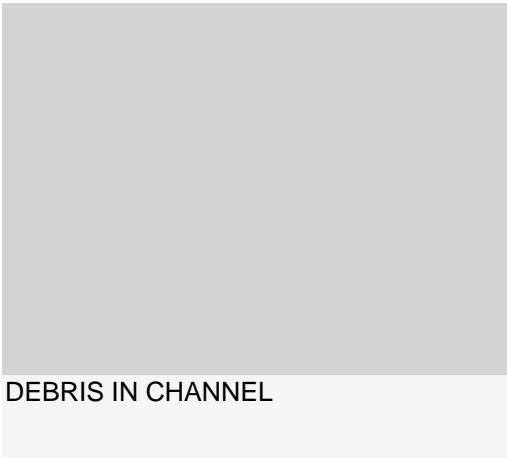


DEBRIS IN CHANNEL

Defect 3

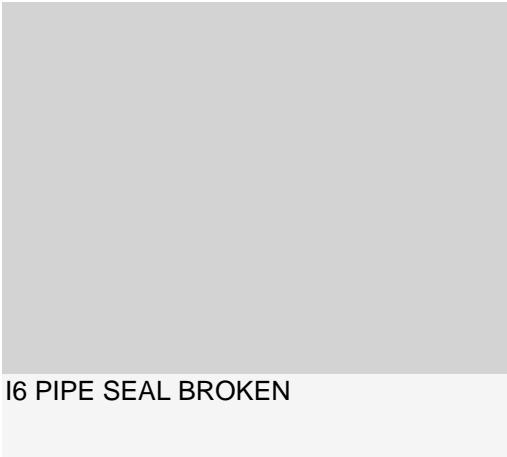

I6 PIPE SEAL BROKEN

Defect 1

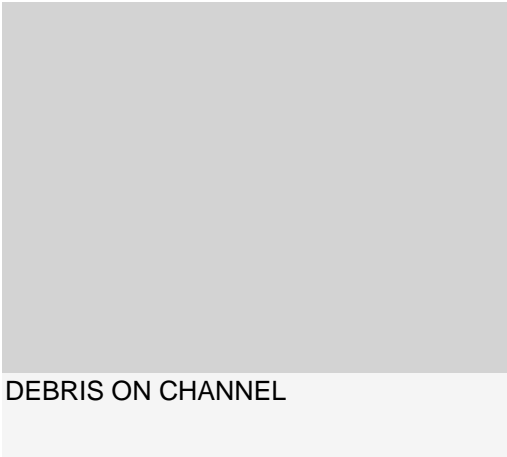

DEBRIS ON CHANNEL

Manhole Inspection Summary

Manhole # S04I__007MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.30** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.00** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection